STATE OF NORTH DAKOTA

BOARD OF WATER WELL CONTRACTORS

900 E. BOULEVARD • BISMARCK, NORTH DAKOTA 58501

WELL DRILLER'S REPORT

State law requires that this report be filed with the State Board of Water Well Contractors within 30 days after completion or abandonment of the well.

1. WELL OWNER

Name Bryce Toay

Address Edgeley N.Dak Rt 1

2. WELL LOCATION

Sketch map location must agree with written location.

NORTH

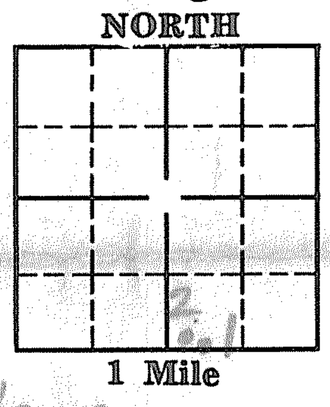

1 Mile

County La Moure

SW ¼ SW ¼ SE ¼ Sec. 18 Twp. 135 N. Rg. 64 W.

3. PROPOSED USE

☐ Domestic ☐ Irrigation ☐ Industrial

☐ Stock ☐ Municipal ☐ Test Hole

4. METHOD DRILLED

☐ Cable ☐ Reverse Rotary ☐ Bored

☑ Forward Rotary ☐ Jetted ☐ Other

If other, specify

5. WATER QUALITY

Was a water sample collected for chemical analysis?

☐ Yes ☑ No

If so, to what laboratory was it sent

6. WELL CONSTRUCTION

Diameter of hole 6¼ inches. Depth 28 feet.

Casing: ☐ Steel ☑ Plastic ☐ Concrete

☐ Threaded ☐ Welded ☐ Other

If other, specify

Pipe Weight:	Diameter:	From:	To:
200 PSI lb/ft.	4 inches	+2 feet	24 feet
lb/ft.	inches	feet	feet
lb/ft.	inches	feet	feet
lb/ft.	inches	feet	feet

Was perforated pipe used? ☐ Yes ☑ No

Length of pipe perforated feet

Was casing left open end? ☐ Yes ☑ No

Was a well screened installed? ☑ Yes ☐ No

Material Stainless steel Diameter 3 inches
(stainless steel, bronze, etc.)

Slot size 18 set from 24 feet to 28 feet

Slot size set from feet to feet

Slot size set from feet to feet

Slot size set from feet to feet

Was a packer or seal used? ☐ Yes ☑ No

If so, what material

Type of well: Straight screen ☐ Gravel packed ☑

Was the well grouted? Yes ☑ No ☐

To what depth? 20 feet

Material used in grouting Neat Cement

Well head completion: Pitless adapter yes

12" above grade yes Other

If other, specify

Was well disinfected upon completion? ☑ Yes ☐ No

7. WATER LEVEL

Static water level 14 feet below land surface

If flowing: closed-in pressure psi

GPM flow through inch pipe

Controlled by: ☐ Valve ☐ Reducers ☐ Other

If other, specify

8. WELL TEST DATA

☑ Pump ☐ Bailer ☐ Other

Pumping level below land surface:

24 ft. after 1 hrs. pumping 10 gpm

ft. after hrs. pumping gpm

ft. after hrs. pumping gpm

9. WELL LOG

Formation	Depth (ft.) From	Depth (ft.) To
① Brown sand	0	13
Brown clay	13	17
coarse sand & gravel	17	28
gray soft silty clay	28	74
Gray coarse sand & gravel caving	74	88
gravel & shale	88	100
Bad samples both from 94 & 100'		
couldn't hold sand		
#2 well		
Brown sand & gravel	0	13
Brown sandy clay	13	16
Gray clay	16	19
sand & gravel	19	21
Gray soft clay	21	22
coarse sand & gravel fairly clean	22	28
Gray soft clay	28	34

(Use separate sheet if necessary.)

10. DATE COMPLETED Oct 10 1983

11. WAS WELL PLUGGED OR ABANDONED?

☑ Yes ☐ No

If so, how #1 was clay fill

12. REMARKS: #1 was cased to 88' where Rods fell through but failed to produce water, pulled and abandoned

13. DRILLER'S CERTIFICATION

This well was drilled under my jurisdiction and this report is true to the best of my knowledge.

Trout Well Drilling 85

Driller's or Firm's Name Certificate No.

933 17th St. SW

Address

Jamestown N Dak

Signed by [signature] Date Oct 10 1983

WHITE—DRILLER'S COPY YELLOW—BOARD'S COPY PINK—CUSTOMER'S COPY