STATE OF NORTH DAKOTA

BOARD OF WATER WELL CONTRACTORS

900 E. BOULEVARD • BISMARCK, NORTH DAKOTA 58501

WELL DRILLER'S REPORT

State law requires that this report be filed with the State Board of Water Well Contractors within 30 days after completion or abandonment of the well.

1. WELL OWNER

Name Bertina Thorung

Address Stanley, ND 58784

2. WELL LOCATION

Sketch map location must agree with written location.

NORTH

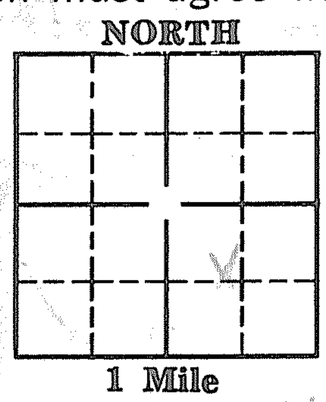

1 Mile

County Mountrail

SE ¼ NW ¼ SE ¼ Sec. 35 Twp. 158 N. Rg. 91 W.

3. PROPOSED USE

☒ Domestic ☐ Irrigation ☐ Industrial
☐ Stock ☐ Municipal ☐ Test Hole

4. METHOD DRILLED

☐ Cable ☐ Reverse Rotary ☐ Bored
☒ Forward Rotary ☐ Jetted ☐ Other

If other, specify

5. WATER QUALITY

Was a water sample collected for chemical analysis?

☐ Yes ☒ No

If so, to what laboratory was it sent

6. WELL CONSTRUCTION

Diameter of hole 8 3/4 inches. Depth 212 feet.

Casing: ☐ Steel ☒ Plastic ☐ Concrete
☐ Threaded ☐ Welded ☐ Other

If other, specify Schedule 40

Pipe Weight:	Diameter:	From:	To:
3 lb/ft.	5 inches	0 feet	212 feet
lb/ft.	inches	feet	feet
lb/ft.	inches	feet	feet
lb/ft.	inches	feet	feet

Was perforated pipe used? ☒ Yes ☐ No

Length of pipe perforated 20 feet

Was casing left open end? ☐ Yes ☒ No

Was a well screened installed? ☐ Yes ☒ No

Material (stainless steel, bronze, etc.) Diameter inches

Slot size set from feet to feet

Slot size set from feet to feet

Slot size set from feet to feet

Slot size set from feet to feet

Was a packer or seal used? ☐ Yes ☒ No

If so, what material

Type of well: Straight screen ☐ Gravel packed ☒

Was the well grouted? Yes ☒ No ☐

To what depth? 10 feet

Material used in grouting drillers mud

Well head completion: Pitless adapter

12" above grade ✓ Other

If other, specify

Was well disinfected upon completion? ☐ Yes ☒ No

7. WATER LEVEL

Static water level 102 feet below land surface

If flowing: closed-in pressure psi

GPM flow through inch pipe

Controlled by: ☐ Valve ☐ Reducers ☐ Other

If other, specify

8. WELL TEST DATA

☐ Pump ☒ Bailer ☐ Other

Pumping level below land surface:

182 ft. after 1 hrs. pumping 10 gpm

ft. after hrs. pumping gpm

ft. after hrs. pumping gpm

9. WELL LOG

Formation	Depth (ft.) From	Depth (ft.) To
Top soil	0	1
yellow clay	1	5
fine medium brn. sand	5	30
blue clay	30	50
sand	50	55
blue clay	55	110
brown hardpan clay	110	111
sandy grn & blue clay	111	182
white hardpan clay	182	183
blue clay	183	206
coal	206	208
blue clay	208	212

(Use separate sheet if necessary.)

10. DATE COMPLETED May 14, 1982

11. WAS WELL PLUGGED OR ABANDONED?

☐ Yes ☒ No

If so, how

12. REMARKS: Top ten feet to be grouted around casing with concrete by customer.

13. DRILLER'S CERTIFICATION

This well was drilled under my jurisdiction and this report is true to the best of my knowledge.

Crowder-Dennis Drilling #61

Driller's or Firm's Name Certificate No.

RR2 Box 69 Stanley, ND 58784

Address

James C. Dennis 5/16/82

Signed by Date

WHITE—DRILLER'S COPY YELLOW—BOARD'S COPY PINK—CUSTOMER'S COPY