STATE OF NORTH DAKOTA

BOARD OF WATER WELL CONTRACTORS

900 E. BOULEVARD • BISMARCK, NORTH DAKOTA 58501

WELL DRILLER'S REPORT

State law requires that this report be filed with the State Board of Water Well Contractors within 30 days after completion or abandonment of the well.

1. WELL OWNER

Name HENRY Gebhardt

Address Mandan, N. Dak.

2. WELL LOCATION

Sketch map location must agree with written location.

NORTH

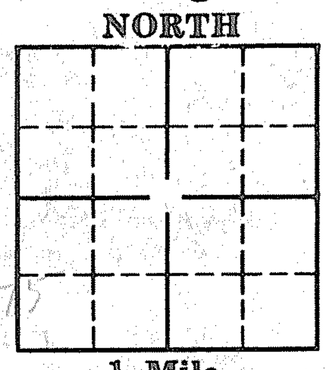

1 Mile

Lot 7 Block 2

County Dickey

SE ¼ ¼ SE ¼ Sec. 8 Twp. 131 N. Rg. 63 W.

3. PROPOSED USE

☐ Geothermal
☒ Domestic ☐ Irrigation ☐ Industrial
☐ Stock ☐ Municipal ☐ Test Hole

4. METHOD DRILLED

☐ Cable ☐ Reverse Rotary ☒ Bored
☐ Forward Rotary ☐ Jetted ☐ Other

If other, specify

5. WATER QUALITY

Was a water sample collected for chemical analysis?

☒ Yes ☐ No

If so, to what laboratory was it sent

6. WELL CONSTRUCTION

Diameter of hole 24 inches. Depth 40 feet.

Casing: ☐ Steel ☐ Plastic ☒ Concrete
☐ Threaded ☐ Welded ☐ Other

If other, specify

Pipe Weight:	Diameter:	From:	To:
lb/ft.	18 ID inches	0 feet	40 feet
lb/ft.	inches	feet	feet
lb/ft.	inches	feet	feet
lb/ft.	inches	feet	feet

Was perforated pipe used? ☐ Yes ☐ No

Length of pipe perforated feet

Was casing left open end? ☒ Yes ☐ No

Was a well screened installed? ☐ Yes ☒ No

Material Diameter inches
(stainless steel, bronze, etc.)

Slot size set from feet to feet

Slot size set from feet to feet

Slot size set from feet to feet

Slot size set from feet to feet

Was a packer or seal used? ☐ Yes ☐ No

If so, what material

Type of well: Straight screen ☐ Gravel packed ☒

Was the well grouted? Yes ☒ No ☐

To what depth? 12 feet

Material used in grouting Cement

Well head completion: Pitless adapter

12" above grade yes Other

If other, specify

Was well disinfected upon completion? ☒ Yes ☐ No

7. WATER LEVEL

Static water level 16 feet below land surface

If flowing: closed-in pressure psi

GPM flow through inch pipe

Controlled by: ☐ Valve ☐ Reducers ☐ Other

If other, specify

8. WELL TEST DATA

☐ Pump ☐ Bailer ☐ Other

Pumping level below land surface:

ft. after hrs. pumping gpm

ft. after hrs. pumping gpm

ft. after hrs. pumping gpm

9. WELL LOG

Formation	Depth (ft.) From	Depth (ft.) To
Topsoil Black	1	2
Clay Silty yellow	2	16
Clay Blue Hard	16	26
Clay mixed c Shale	26	34
Shale	34	40

(Use separate sheet if necessary.)

10. DATE COMPLETED 9-12-86

11. WAS WELL PLUGGED OR ABANDONED?

☐ Yes ☐ No

If so, how NO WELL

12. REMARKS:

WELL S.W. CORNER of HOUSE

13. DRILLER'S CERTIFICATION

This well was drilled under my jurisdiction and this report is true to the best of my knowledge.

Gilbert Well Work 76

Driller's or Firm's Name Certificate No.

Long Lake S.D.

Address

Richard Gilbert 10-20-86

Signed by Date

WHITE—DRILLER'S COPY YELLOW—BOARD'S COPY PINK—CUSTOMER'S COPY