STATE OF NORTH DAKOTA

BOARD OF WATER WELL CONTRACTORS

900 E. BOULEVARD • BISMARCK, NORTH DAKOTA 58501

WELL DRILLER'S REPORT

State law requires that this report be filed with the State Board of Water Well Contractors within 30 days after completion or abandonment of the well.

1. WELL OWNER

Name Ted Kilwein

Address 121-5th Ave. S.E. Dickinson, ND 58601

2. WELL LOCATION

Sketch map location must agree with written location.

NORTH

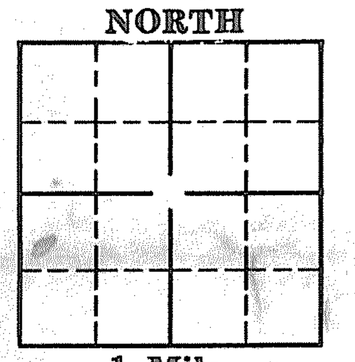

1 Mile

County Dunn

LOT 7 ¼ ¼ ¼ Sec. 25 Twp. 146 N. Rg. 97 W.

3. PROPOSED USE

☒ Domestic ☐ Irrigation ☐ Industrial
☐ Stock ☐ Municipal ☐ Test Hole

4. METHOD DRILLED

☐ Cable ☐ Reverse Rotary ☐ Bored
☒ Forward Rotary ☐ Jetted ☐ Other

If other, specify

5. WATER QUALITY

Was a water sample collected for chemical analysis?

☐ Yes ☒ No

If so, to what laboratory was it sent

6. WELL CONSTRUCTION

Diameter of hole 7⅞ inches. Depth 380 feet.

Casing: ☐ Steel ☒ Plastic ☐ Concrete
☐ Threaded ☐ Welded ☐ Other

If other, specify

Pipe Weight:	Diameter:	From:	To:
200 lb/ft.	4 inches	0 feet	352 feet
lb/ft.	inches	feet	feet
lb/ft.	inches	feet	feet
lb/ft.	inches	feet	feet

Was perforated pipe used? ☒ Yes ☐ No

Length of pipe perforated 20' feet

Was casing left open end? ☐ Yes ☒ No

Was a well screened installed? ☒ Yes ☐ No

Material (stainless steel, bronze, etc.) Diameter 4 inches

Slot size .035 set from 352 feet to 372 feet

Slot size set from feet to feet

Slot size set from feet to feet

Was a packer or seal used? ☐ Yes ☒ No

If so, what material

Type of well: Straight screen ☐ Gravel packed ☒ (SAND)

Was the well grouted? Yes ☒ No ☐

To what depth? 8-18 feet

Material used in grouting CEMENT

Well head completion: Pitless adapter

12" above grade ✓ Other

If other, specify

Was well disinfected upon completion? ☒ Yes ☐ No

7. WATER LEVEL

Static water level feet below land surface

If flowing: closed-in pressure psi

GPM flow through inch pipe

Controlled by: ☐ Valve ☐ Reducers ☐ Other

If other, specify

8. WELL TEST DATA

☐ Pump ☐ Bailer ☐ Other

Pumping level below land surface:

ft. after hrs. pumping gpm

ft. after hrs. pumping gpm

ft. after hrs. pumping gpm

9. WELL LOG

Formation	Depth (ft.) From	To
Sandstone	239	241
Shy sand- some coal	241	245
Rock	245	246
Sand- grey (dry)	246	254
Rock	254	255
Coal- grey shale	255	261
Blue green shale	261	270
Blue green shale-sandy	270	281
Blue green firm shale	281	285
Blue grey shale	285	305
Blue green shale-sandy	305	325
Sandstone	325	336
Blue green shale-sandy	336	350
Blue green sandy (water)	350	372
Rock	372	373
Shy shale	373	380

(Use separate sheet if necessary.)

10. DATE COMPLETED 6/27/84

11. WAS WELL PLUGGED OR ABANDONED?

☐ Yes ☒ No

If so, how

12. REMARKS:

CLEAR WATER

13. DRILLER'S CERTIFICATION

This well was drilled under my jurisdiction and this report is true to the best of my knowledge.

Trident Drilling Inc. 157

Driller's or Firm's Name Certificate No.

BOX 37, MANNING, ND 58642

Address

Marvin Hunsinger 7/27/84

Signed by Date

WHITE—DRILLER'S COPY YELLOW—BOARD'S COPY PINK—CUSTOMER'S COPY