STATE OF NORTH DAKOTA

BOARD OF WATER WELL CONTRACTORS

900 E. BOULEVARD • BISMARCK, NORTH DAKOTA 58501

WELL DRILLER'S REPORT

State law requires that this report be filed with the State Board of Water Well Contractors within 30 days after completion or abandonment of the well.

1. WELL OWNER

Name Edd Johnson

Address New Rockford, ND

2. WELL LOCATION

Sketch map location must agree with written location.

NORTH

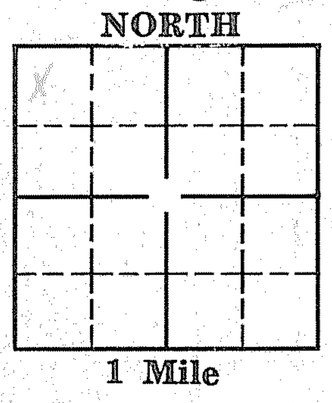

1 Mile

County Eddy

NW ¼ NW ¼ NW ¼ Sec. 25 Twp. 148 N. Rg. 66 W.

3. PROPOSED USE

☐ Domestic ☐ Irrigation ☐ Industrial

☐ Stock ☐ Municipal ☐ Test Hole

4. METHOD DRILLED

☐ Cable ☐ Reverse Rotary ☐ Bored

☐ Forward Rotary ☐ Jetted ☐ Other

If other, specify

5. WATER QUALITY

Was a water sample collected for chemical analysis?

☐ Yes ☒ No

If so, to what laboratory was it sent

6. WELL CONSTRUCTION

Diameter of hole 6 inches. Depth 20 feet.

Casing: ☒ Steel ☐ Plastic ☐ Concrete

☒ Threaded ☐ Welded ☐ Other

If other, specify

Pipe Weight:	Diameter:	From:	To:
11 lb/ft.	4 inches	0 feet	124 feet
lb/ft.	inches	feet	feet
lb/ft.	inches	feet	feet
lb/ft.	inches	feet	feet

Was perforated pipe used? ☐ Yes ☒ No

Length of pipe perforated feet

Was casing left open end? ☒ Yes ☐ No

Was a well screened installed? ☐ Yes ☒ No

Material Diameter inches
(stainless steel, bronze, etc.)

Slot size set from feet to feet

Slot size set from feet to feet

Slot size set from feet to feet

Slot size set from feet to feet

Was a packer or seal used? ☐ Yes ☒ No

If so, what material

Type of well: Straight screen ☐ Gravel packed ☐

Was the well grouted? Yes ☒ No ☐

To what depth? 20 feet

Material used in grouting cement

Well head completion: Pitless adapter

2" above grade X Other

other, specify

s well disinfected upon completion? ☒ Yes ☐ No

7. WATER LEVEL

Static water level 75 feet below land surface

If flowing: closed-in pressure psi

GPM flow through inch pipe

Controlled by: ☐ Valve ☐ Reducers ☐ Other

If other, specify

8. WELL TEST DATA

☐ Pump ☒ Bailer ☐ Other

Pumping level below land surface:

120 ft. after 2 hrs. pumping 3 gpm

100 ft. after 1 hrs. pumping 2 gpm

ft. after hrs. pumping gpm

9. WELL LOG

Formation	Depth (ft.) From	Depth (ft.) To
Black top	0	1
Yellow Clay	1	9
Sand	9	10
Yellow Clay w/ cobbles & gravel	10	23
Clean washed sand	23	33
Rocks	33	34
Clay	34	69
Sand	69	88
Shale	88	150

(Use separate sheet if necessary.)

10. DATE COMPLETED 7-21-79

11. WAS WELL PLUGGED OR ABANDONED?

☐ Yes ☒ No

If so, how

12. REMARKS: good well - soft water

use 120' of pump

13. DRILLER'S CERTIFICATION

This well was drilled under my jurisdiction and this report is true to the best of my knowledge.

Riedahl Water Well Drilling 49

Driller's or Firm's Name Certificate No.

Hillsville ND 322-5127

Address

David C. Riedahl 7-21-79

Signed by Date

TE — BOARD'S COPY