STATE OF NORTH DAKOTA

BOARD OF WATER WELL CONTRACTORS

900 E. BOULEVARD • BISMARCK, NORTH DAKOTA 58501

WELL DRILLER'S REPORT

State law requires that this report be filed with the State Board of Water Well Contractors within 30 days after completion or abandonment of the well.

1. WELL OWNER

Name Harry Becherl

Address Cooperstown N. D.

2. WELL LOCATION

Sketch map location must agree with written location.

NORTH

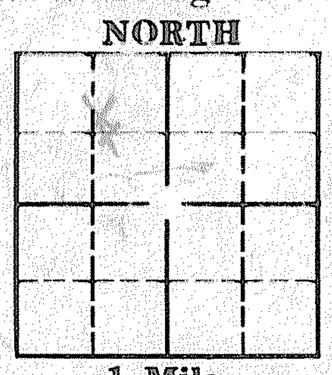

1 Mile

County Griggs

NW ¼ SE ¼ NW ¼ Sec. 20 Twp. 147 N. Rg. 59 W.

3. PROPOSED USE

☐ Domestic ☐ Irrigation ☐ Industrial
☒ Stock ☐ Municipal ☐ Test Hole

4. METHOD DRILLED

☐ Cable ☐ Reverse Rotary ☒ Bored
☐ Forward Rotary ☐ Jetted ☐ Other

If other, specify

5. WATER QUALITY

Was a water sample collected for chemical analysis?

☐ Yes ☒ No

If so, to what laboratory was it sent

6. WELL CONSTRUCTION

Diameter of hole 30 inches. Depth 35 feet.

Casing: ☒ Steel ☐ Plastic ☐ Concrete
☐ Threaded ☐ Welded ☐ Other

If other, specify

Pipe Weight:	Diameter:	From:	To:
16 ga lb/ft.	24 inches	0 feet	36 feet
lb/ft.	inches	feet	feet
lb/ft.	inches	feet	feet
lb/ft.	inches	feet	feet

Was perforated pipe used? ☒ Yes ☐ No

Length of pipe perforated 12 feet

Was casing left open end? ☒ Yes ☐ No

Was a well screened installed? ☐ Yes ☒ No

Material Diameter inches
(stainless steel, bronze, etc.)

Slot size set from feet to feet

Slot size set from feet to feet

Slot size set from feet to feet

Slot size set from feet to feet

Was a packer or seal used? ☐ Yes ☒ No

If so, what material

Type of well: Straight screen ☐ Gravel packed ☒

Was the well grouted? Yes ☐ No ☒

To what depth? feet

Material used in grouting

Well head completion: Pitless adapter

12" above grade Other

If other, specify

Was well disinfected upon completion? ☒ Yes ☐ No

7. WATER LEVEL

Static water level 17 feet below land surface

If flowing: closed-in pressure psi

GPM flow through inch pipe

Controlled by: ☐ Valve ☐ Reducers ☐ Other

If other, specify

8. WELL TEST DATA

☐ Pump ☐ Bailer ☒ Other

Pumping level below land surface:

ft. after hrs. pumping 20 gpm

ft. after hrs. pumping gpm

ft. after hrs. pumping gpm

9. WELL LOG

Formation	Depth (ft.) From	Depth (ft.) To
Top Soil	0	2
Yellow Clay	2	8
Sand layers in Clay	8	16
Blue Clay	16	20
Sandy Blue Clay	20	26
Hard Blue Clay	26	35
Gravel - Rock	35	

(Use separate sheet if necessary.)

10. DATE COMPLETED Mar 13 1975

11. WAS WELL PLUGGED OR ABANDONED?

☐ Yes ☒ No

If so, how

12. REMARKS:

Very strong stream about 3" diameter poured out of side of well at 26' Owner will back fill

13. DRILLER'S CERTIFICATION

This well was drilled under my jurisdiction and this report is true to the best of my knowledge.

Lyle A. Burchill

Driller's or Firm's Name Certificate No.

Hope N. Dak.

Address

Lyle Burchill 19 1975

Signed by Date

DUPLICATE — BOARD'S COPY