STATE OF NORTH DAKOTA

BOARD OF WATER WELL CONTRACTORS

900 E. BOULEVARD • BISMARCK, NORTH DAKOTA 58501

WELL DRILLER'S REPORT

State law requires that this report be filed with the State Board of Water Well Contractors within 30 days after completion or abandonment of the well.

1. WELL OWNER

Name: Vern Meidinger

Address: 8965 22th Ave SE Reeland, N.D. 58801

2. WELL LOCATION

Sketch map location must agree with written location.

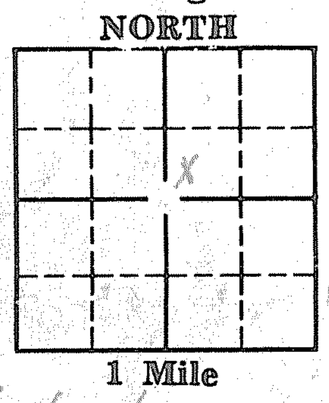

County: McIntosh

W½ S ¼ E ½ NE ¼ Sec. 34 Twp. 131 N. Rg. 73 W.

3. PROPOSED USE

☐ Geothermal
☑ Domestic ☐ Irrigation ☐ Industrial
☐ Stock ☐ Municipal ☐ Test Hole

4. METHOD DRILLED

☐ Cable ☐ Reverse Rotary ☑ Bored
☐ Forward Rotary ☐ Jetted ☐ Other

If other, specify

5. WATER QUALITY

Was a water sample collected for chemical analysis?

☐ Yes ☐ No

If so, to what laboratory was it sent

6. WELL CONSTRUCTION

Diameter of hole 28" inches. Depth 62' feet.

Casing: ☑ Steel ☐ Plastic ☑ Concrete
☐ Threaded ☐ Welded ☐ Other

If other, specify

Pipe Weight:	Diameter:	From:	To:
80.8 lb/ft.	20" I.D. inches	10' feet	62' feet
14.92 lb/ft.	5" inches	8' feet	10' feet
lb/ft.	inches	feet	feet
lb/ft.	inches	feet	feet

Was perforated pipe used? ☐ Yes ☑ No

Length of pipe perforated feet

Was casing left open end? ☑ Yes ☐ No

Was a well screened installed? ☐ Yes ☑ No

Material Porous Haydite Concrete Diameter 20" inches
(stainless steel, bronze, etc.)

Slot size set from feet to feet

Slot size set from feet to feet

Slot size set from feet to feet

Slot size set from feet to feet

Was a packer or seal used? ☐ Yes ☑ No

If so, what material

Type of well: Straight screen ☐ Gravel packed ☑

Was the well grouted? Yes ☑ No ☐

To what depth? 8' to 24' feet

Material used in grouting Granular Bentonite & neat cement

Well head completion: Pitless adapter Manitor

12" above grade 6" w/ Vented Cap Other 7' Bury

If other, specify

Was well disinfected upon completion? ☑ Yes ☐ No

7. WATER LEVEL

Static water level 25'6" feet below land surface

If flowing: closed-in pressure psi

GPM flow through inch pipe

Controlled by: ☐ Valve ☐ Reducers ☐ Other

If other, specify

8. WELL TEST DATA

☐ Pump ☑ Bailer ☐ Other

Pumping level below land surface:

58' ft. after 2 hrs. pumping 2-8 gpm

ft. after hrs. pumping gpm

ft. after hrs. pumping gpm

9. WELL LOG

Formation	Depth (ft.) From	Depth (ft.) To
Topsoil	0	1
Light Black sandy clay	1	4
Light Brown sandy clay	4	24
Light Brown-green-yellow sand and sandstone	24	26'
Brown-green-yellow sand (water Bearing	26'	45'
Gray hard clay	45	52'
Gray hard clay w/Blue-green sand stringers	52	62'
Stopped after hitting rock on bottom.		

(Use separate sheet if necessary.)

10. DATE COMPLETED 8-22-97

11. WAS WELL PLUGGED OR ABANDONED?

☐ Yes ☑ No

If so, how

12. REMARKS: Well located Northwest of house about 120'

13. DRILLER'S CERTIFICATION

This well was drilled under my jurisdiction and this report is true to the best of my knowledge.

Abele Well Service ///
Driller's or Firm's Name Certificate No.

Mobridge, S. Dak.
Address

Jerome Abele 8/29/97
Signed by Date

WHITE—DRILLER'S COPY YELLOW—BOARD'S COPY PINK—CUSTOMER'S COPY