STATE OF NORTH DAKOTA

BOARD OF WATER WELL CONTRACTORS

900 E. BOULEVARD • BISMARCK, NORTH DAKOTA 58501

WELL DRILLER'S REPORT

State law requires that this report be filed with the State Board of Water Well Contractors within 30 days after completion or abandonment of the well.

1. WELL OWNER

Name: Dan Stuckle 435-2511

Address: Courtenay, North Dakota

2. WELL LOCATION

Sketch map location must agree with written location.

NORTH

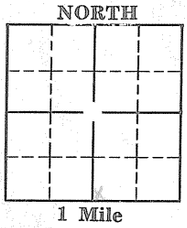

1 Mile

County: Stutsman

SW ¼ SW ¼ SE ¼ Sec. 3 Twp. 142 N. Rg. 63 W.

3. PROPOSED USE

☒ Domestic ☐ Irrigation ☐ Industrial
☐ Stock ☐ Municipal ☐ Test Hole

4. METHOD DRILLED

☐ Cable ☐ Reverse Rotary ☐ Bored
☒ Forward Rotary ☐ Jetted ☐ Other

If other, specify

5. WATER QUALITY

Was a water sample collected for chemical analysis?

☐ Yes ☒ No

If so, to what laboratory was it sent

6. WELL CONSTRUCTION

Diameter of hole 18 inches. Depth 135 feet.

Casing: ☐ Steel ☒ Plastic ☐ Concrete
☐ Threaded ☐ Welded ☐ Other

If other, specify

Pipe Weight:	Diameter:	From:	To:
200 lb/ft.	5 inches	0 feet	135 feet
lb/ft.	inches	feet	feet
lb/ft.	inches	feet	feet
lb/ft.	inches	feet	feet

Was perforated pipe used? ☒ Yes ☐ No

Length of pipe perforated 66 feet

Was casing left open end? ☒ Yes ☐ No

Was a well screened installed? ☐ Yes ☒ No

Material (stainless steel, bronze, etc.) Diameter inches

Slot size set from feet to feet

Slot size set from feet to feet

Slot size set from feet to feet

Slot size set from feet to feet

Was a packer or seal used? ☐ Yes ☒ No

If so, what material

Type of well: Straight screen ☐ Gravel packed ☒

Was the well grouted? Yes ☒ No ☐

To what depth? 10 feet

Material used in grouting Cement

Well head completion: Pitless adapter Yes

12" above grade Yes Other

If other, specify

Was well disinfected upon completion? ☒ Yes ☐ No

7. WATER LEVEL

Static water level 100 feet below land surface

If flowing: closed-in pressure psi

GPM flow through inch pipe

Controlled by: ☐ Valve ☐ Reducers ☐ Other

If other, specify

8. WELL TEST DATA

☒ Pump ☐ Bailer ☐ Other

Pumping level below land surface:

50 ft. after 3 hrs. pumping 10 gpm

ft. after hrs. pumping gpm

ft. after hrs. pumping gpm

9. WELL LOG

Formation	Depth (ft.) From	Depth (ft.) To
Black dirt	0	1
Yellow sandy clay	1	30
Blue clay	30	60
Rock bed	60	65
Shale	65	135

(Use separate sheet if necessary.)

10. DATE COMPLETED November 12, 1980

11. WAS WELL PLUGGED OR ABANDONED?

☐ Yes ☒ No

If so, how

12. REMARKS:

13. DRILLER'S CERTIFICATION

This well was drilled under my jurisdiction and this report is true to the best of my knowledge.

Scherbenske Excavating, Inc. 70

Driller's or Firm's Name Certificate No.

Route 7, Jamestown, North Dakota 58401

Address

NORMAN W. SCHERBENSKE 12/03/80

Signed by Date

DUPLICATE — BOARD'S COPY