STATE OF NORTH DAKOTA
BOARD OF WATER WELL CONTRACTORS
900 E. BOULEVARD • BISMARCK, NORTH DAKOTA 58501

WELL DRILLER'S REPORT

State law requires that this report be filed with the State Board of Water Well Contractors within 30 days after completion or abandonment of the well.

For Haigdal Elev.

1. WELL OWNER

Name: Fessenden Coop Elev.

Address: Fessenden, ND.

2. WELL LOCATION

Sketch map location must agree with written location.

NORTH

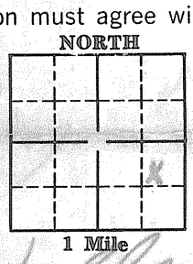

1 Mile

County: Wells

SW ¼ NE ¼ SE ¼ Sec. 20 Twp. 150 N. Rg. 70 W.

3. PROPOSED USE

☑ Domestic ☐ Irrigation ☐ Industrial
☐ Stock ☐ Municipal ☐ Test Hole

4. METHOD DRILLED

☐ Cable ☐ Reverse Rotary ☑ Bored
☐ Forward Rotary ☐ Jetted ☐ Other

If other, specify

5. WATER QUALITY

Was a water sample collected for chemical analysis?
☐ Yes ☑ No

If so, to what laboratory was it sent

6. WELL CONSTRUCTION

Diameter of hole 38 inches. Depth 21 feet.

Casing: ☐ Steel ☐ Plastic ☑ Concrete
☐ Threaded ☐ Welded ☐ Other

If other, specify

Pipe Weight:	Diameter:	From:	To:
265 lb/ft.	24 inches	+3 feet	-21 feet
lb/ft.	inches	feet	feet
lb/ft.	inches	feet	feet
lb/ft.	inches	feet	feet

Was perforated pipe used? ☑ Yes ☐ No

Length of pipe perforated 4 feet

Was casing left open end? ☐ Yes ☑ No

Was a well screened installed? ☐ Yes ☑ No

Material (stainless steel, bronze, etc.) Diameter inches

Slot size set from feet to feet

Slot size set from feet to feet

Slot size set from feet to feet

Slot size set from feet to feet

Was a packer or seal used? ☐ Yes ☑ No

If so, what material

Type of well: Straight screen ☐ Gravel packed ☑

Was the well grouted? Yes ☑ No ☐

To what depth? 10' feet

Material used in grouting Ready Mix Concrete

Well head completion: Pitless adapter

12" above grade Other

If other, specify 3' above grade

Was well disinfected upon completion? ☐ Yes ☑ No

7. WATER LEVEL

Static water level 13 feet below land surface

If flowing: closed-in pressure psi

GPM flow through inch pipe

Controlled by: ☐ Valve ☐ Reducers ☐ Other

If other, specify

8. WELL TEST DATA

☐ Pump ☑ Bailer ☐ Other

Pumping level below land surface:

15 ft. after 1 hrs. pumping 25 gpm

ft. after hrs. pumping gpm

ft. after hrs. pumping gpm

9. WELL LOG

Formation	Depth (ft.) From	Depth (ft.) To
Blacktop soil (Fill)	0	2
Blacktop soil	2	4
Sandy yellow clay	4	5
Yellow sand	5	14
Water		
Yellow sand	14	17
gravel	17	19
1" rocks	19	21
8' S		
4' S		
4' S		
4' S		
4' P		

(Use separate sheet if necessary.)

10. DATE COMPLETED 10-20-83

11. WAS WELL PLUGGED OR ABANDONED?

☐ Yes ☐ No

If so, how

12. REMARKS: False Curb.

13. DRILLER'S CERTIFICATION

This well was drilled under my jurisdiction and this report is true to the best of my knowledge.

Nuttall Boring 126
Driller's or Firm's Name Certificate No.

Bisbee, ND
Address

Nelson Chenal 10-20-83
Signed by Date

WHITE—DRILLER'S COPY YELLOW—BOARD'S COPY PINK—CUSTOMER'S COPY