STATE OF NORTH DAKOTA

BOARD OF WATER WELL CONTRACTORS

900 E. BOULEVARD • BISMARCK, NORTH DAKOTA 58501

WELL DRILLER'S REPORT

State law requires that this report be filed with the State Board of Water Well Contractors within 30 days after completion or abandonment of the well.

1. WELL OWNER

Name Ken Sikba

Address Bowman

2. WELL LOCATION

Sketch map location must agree with written location.

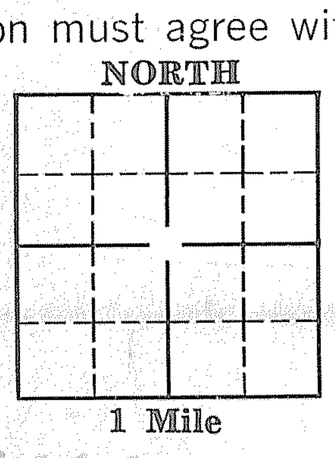

County Bowman

SW ¼ NE ¼ NE ¼ Sec. 22 Twp. 132 N. Rg. 101 W.

3. PROPOSED USE

☐ Domestic ☐ Irrigation ☐ Industrial

☒ Stock ☐ Municipal ☐ Test Hole

4. METHOD DRILLED

☐ Cable ☐ Reverse Rotary ☐ Bored

☒ Forward Rotary ☐ Jetted ☐ Other

If other, specify

5. WATER QUALITY

Was a water sample collected for chemical analysis?

☐ Yes ☒ No

If so, to what laboratory was it sent

6. WELL CONSTRUCTION

Diameter of hole 5 inches. Depth 59 feet.

Casing: ☐ Steel ☒ Plastic ☐ Concrete

☐ Threaded ☐ Welded ☐ Other

If other, specify

Pipe Weight:	Diameter:	From:	To:
200 lb/ft.	inches	feet	feet
lb/ft.	inches	feet	feet
lb/ft.	inches	feet	feet
lb/ft.	inches	feet	feet

Was perforated pipe used? ☒ Yes ☐ No

Length of pipe perforated 42 feet

Was casing left open end? ☐ Yes ☒ No

Was a well screened installed? ☒ Yes ☐ No

Material PVC Diameter 5 inches
(stainless steel, bronze, etc.)

Slot size .030 set from 42 feet to 54 feet

Slot size set from feet to feet

Slot size set from feet to feet

Slot size set from feet to feet

Was a packer or seal used? ☐ Yes ☒ No

If so, what material

Type of well: Straight screen ☐ Gravel packed ☒

Was the well grouted? Yes ☒ No ☐

To what depth? 0-10 feet

Material used in grouting Cement

Well head completion: Pitless adapter

12" above grade X Other

If other, specify

Was well disinfected upon completion? ☒ Yes ☐ No

7. WATER LEVEL

Static water level 42 feet below land surface

If flowing: closed-in pressure psi

GPM flow through inch pipe

Controlled by: ☐ Valve ☐ Reducers ☐ Other

If other, specify

8. WELL TEST DATA

☐ Pump ☐ Bailer ☒ Other

Pumping level below land surface:

54 ft. after 1 hrs. pumping 8 gpm

ft. after hrs. pumping gpm

ft. after hrs. pumping gpm

9. WELL LOG

Formation	Depth (ft.) From	Depth (ft.) To
See Attached Log		

(Use separate sheet if necessary.)

10. DATE COMPLETED 5-11-81

11. WAS WELL PLUGGED OR ABANDONED?

☐ Yes ☒ No

If so, how

12. REMARKS:

13. DRILLER'S CERTIFICATION

This well was drilled under my jurisdiction and this report is true to the best of my knowledge.

H & H Service Co. 16

Driller's or Firm's Name Certificate No.

Bowman, No Dak

Address

Boyd Kimball 5-21-81

Signed by X Date

UPLICATE — BOARD'S COPY

DRILLER'S LOG

H & H Drilling & Service Co.

Box 916 — Bowman, North Dakota 58623

Ken Silha

Bowman

State Coordinates

N.

E.

Sec. 22

Tp. 132

Rg. 101

Date: 5-11-61

State: No Dak

County: Bowman

SW ¼ N E ¼ N E ¼

Hole Elev.

Core Recovery (Thickness)	From	To	Sample	Description	Comments
	0	20		Yellow Sand	
	20	38		Sandy Clay	
	38	43		Blue Clay	
	43	46		Coal	
	46	49		Clay	
	49	54		Coal	
	54	59		Clay	