STATE OF NORTH DAKOTA

BOARD OF WATER WELL CONTRACTORS

900 E. BOULEVARD • BISMARCK, NORTH DAKOTA 58501

WELL DRILLER'S REPORT

State law requires that this report be filed with the State Board of Water Well Contractors within 30 days after completion or abandonment of the well.

1. WELL OWNER

Name: Mrs Ben Bandley

Address: RR 4 Minot ND

2. WELL LOCATION

Sketch map location must agree with written location.

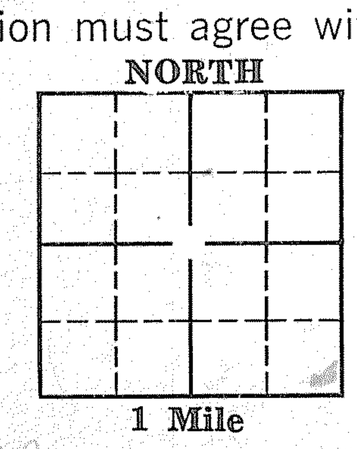

County: WARD

SE ¼ SE ¼ Sec. 13 Twp. 154 N. Rg. 82 W.

3. PROPOSED USE

☒ Domestic ☐ Irrigation ☐ Industrial
☐ Stock ☐ Municipal ☐ Test Hole

4. METHOD DRILLED

☒ Cable ☐ Reverse Rotary ☐ Bored
☐ Forward Rotary ☐ Jetted ☐ Other

If other, specify

5. WATER QUALITY

Was a water sample collected for chemical analysis?

☒ Yes ☐ No

If so, to what laboratory was it sent: WATER MAIN

6. WELL CONSTRUCTION

Diameter of hole: 4 inches. Depth: 80 feet.

Casing: ☒ Steel ☐ Plastic ☐ Concrete
☒ Threaded ☐ Welded ☐ Other

If other, specify

Pipe Weight:	Diameter:	From:	To:
11 lb/ft.	4 inches	0 feet	78 feet
lb/ft.	inches	feet	feet
lb/ft.	inches	feet	feet
lb/ft.	inches	feet	feet

Was perforated pipe used? ☐ Yes ☒ No

Length of pipe perforated: feet

Was casing left open end? ☐ Yes ☒ No

Was a well screened installed? ☒ Yes ☐ No

Material: STAINLESS STEEL (stainless steel, bronze, etc.) Diameter: 3 inches

Slot size: 12 set from: 78 feet to: 80 feet

Slot size: set from: feet to: feet

Slot size: set from: feet to: feet

Slot size: set from: feet to: feet

Was a packer or seal used? ☒ Yes ☐ No

If so, what material: K PAKER

Type of well: Straight screen ☒ Gravel packed ☐

Was the well grouted? Yes ☒ No ☐

To what depth? 10 ft feet

Material used in grouting: CEMENT

Well head completion: Pitless adapter: YES

12" above grade: Other:

If other, specify:

Was well disinfected upon completion? ☒ Yes ☐ No

7. WATER LEVEL

Static water level: 18 feet below land surface

If flowing: closed-in pressure: psi

GPM flow: through: inch pipe

Controlled by: ☐ Valve ☐ Reducers ☐ Other

If other, specify:

8. WELL TEST DATA

☒ Pump ☐ Bailer ☐ Other

Pumping level below land surface:

70 ft. after 4 hrs. pumping 4 gpm

ft. after hrs. pumping gpm

ft. after hrs. pumping gpm

9. WELL LOG

Formation	Depth (ft.) From	Depth (ft.) To
TOP SOIL	0	5
HARD CLAY	5	12
SOFT BLUE CLAY	12	34
GRAVEL	34	35
GRAVEL & CLAY	35	40
SAND & CLAY	40	62
MUDDY SAND & WATER	62	63
SOFT GREY CLAY	63	77
SAND & GRAVEL	77	80

(Use separate sheet if necessary.)

10. DATE COMPLETED OCT 20, 1988

11. WAS WELL PLUGGED OR ABANDONED?

☐ Yes ☒ No

If so, how:

12. REMARKS:

13. DRILLER'S CERTIFICATION

This well was drilled under my jurisdiction and this report is true to the best of my knowledge.

STEMEN DRILLING CO — Driller's or Firm's Name — #7 Certificate No.

340 1ST AVE — Address

DeLan Stemen — Signed by — MAY 3, 1988 Date

DUPLICATE — BOARD'S COPY