STATE OF NORTH DAKOTA

BOARD OF WATER WELL CONTRACTORS

900 E. BOULEVARD • BISMARCK, NORTH DAKOTA 58501

WELL DRILLER'S REPORT

State law requires that this report be filed with the State Board of Water Well Contractors within 30 days after completion or abandonment of the well.

1. WELL OWNER

Name Leroy Goebel

Address Rt. 4 E. Box 198, Williston, ND

2. WELL LOCATION

Sketch map location must agree with written location.

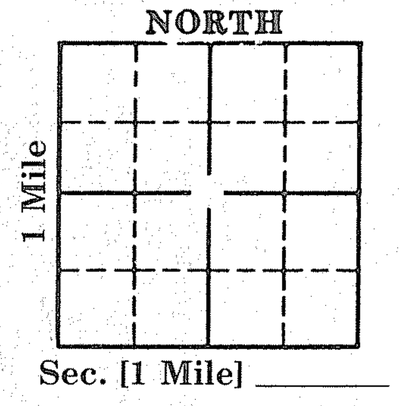

County 53

SE ¼ SE ¼ NW ¼ Sec. 18 Twp. 155 N. Rg. 99 W.

3. PROPOSED USE

☐ Geothermal ☐ Monitoring
☒ Domestic ☐ Irrigation ☐ Industrial
☐ Stock ☐ Municipal ☐ Test Hole

4. METHOD DRILLED

☐ Cable ☐ Reverse Rotary ☐ Bored
☒ Forward Rotary ☐ Jetted ☐ Auger

If other, specify

5. WATER QUALITY

Was a water sample collected for chemical analysis?

☐ Yes ☒ No

If so, to what laboratory was it sent

6. WELL CONSTRUCTION

Diameter of hole 7 7/8 inches. Depth 66 feet.

Casing: ☐ Steel ☒ Plastic ☐ Concrete
☐ Threaded ☐ Welded ☐ Other

If other, specify

Pipe Weight:	Diameter:	From:	To:
200 lb/ft.	5 inches	0 feet	66 feet
lb/ft.	inches	feet	feet
lb/ft.	inches	feet	feet

Was perforated pipe used? ☒ Yes ☐ No

Perforated pipe set from 56 ft to 66 feet

Was casing left open end? ☒ Yes ☐ No

Was a well screened installed? ☐ Yes ☒ No

Material Diameter inches
(stainless steel, bronze, etc.)

Slot size .025 set from 56 feet to 66 feet

Slot size set from feet to feet

Was a packer or seal used? ☐ Yes ☒ No

If so, what material Depth Ft.

Type of well: Straight screen ☐ Gravel packed ☒

Depth grouted: From 0 To 30

Grouting Material: Cement X Other

If other explain:

Well head completion: Pitless unit By owner

12" above grade Other

If other, specify

Was pump installed: ☐ Yes ☒ No

Was well disinfected upon completion? ☐ Yes ☒ No

7. WATER LEVEL

Static water level 12' feet below land surface

If flowing: closed-in pressure psi

GPM flow through inch pipe

Controlled by: ☐ Valve ☐ Reducers ☐ Other

If other, specify

8. WELL TEST DATA

☐ Pump ☒ Bailer ☐ Other

Pumping level below land surface:

44 ft. after 2 hrs. pumping 14 gpm

ft. after hrs. pumping gpm

ft. after hrs. pumping gpm

9. WELL LOG

Formation	Depth (ft.) From	Depth (ft.) To
Top soil	0	1
Sand	1	3
Clay	3	12
Gravel	12	16
Clay	16	38
Gravel	38	41
Clay	41	60
Coal	60	62
Clay	62	64
Coal	64	67

(Use separate sheet if necessary.)

10. DATE COMPLETED 11/6/87

11. WAS WELL PLUGGED OR ABANDONED?

☐ Yes ☒ No

If so, how

12. REMARKS:

13. DRILLER'S CERTIFICATION

This well was drilled under my jurisdiction and this report is true to the best of my knowledge.

SEIDEL SERVICES, INC. 140
Driller's or Firm's Name Certificate No.

Rt. 4 Box 45
Address

Signed by 11/6/87
Date

WHITE—DRILLER'S COPY YELLOW—BOARD'S COPY PINK—CUSTOMER'S COPY