STATE OF NORTH DAKOTA
BOARD OF WATER WELL CONTRACTORS
900 E. BOULEVARD AVE., DEPT. 770 • BISMARCK, NORTH DAKOTA 58505-0850

WELL DRILLER'S REPORT

State law requires that this report be filed with the State Board of Water Well Contractors within 30 days after completion or abandonment of the well.

1. WELL OWNER
Name Howard Schiwal
Address 1027 1 Av. W.
New England N.D

2. WELL LOCATION
Sketch map location must agree with written location.

NORTH

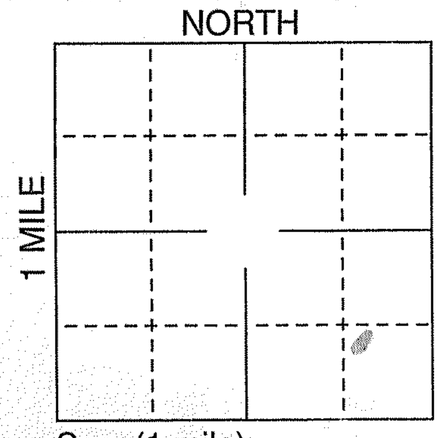

Sec. (1 mile)_____
County Hettinger
SE 1/4 SE 1/4 SE 1/4 Sec. 4 Twp. 136 N.Rg 99 W.

3. PROPOSED USE
☒ Domestic ☐ Stock ☐ Geothermal ☐ Irrigation ☐ Municipal ☐ Monitoring ☐ Industrial ☐ Test Hole

4. METHOD DRILLED
☐ Cable ☐ Reverse Rotary ☐ Bored
☒ Forward Rotary ☐ Jetted ☐ Auger
If other, specify _____

5. WATER QUALITY
Was a water sample collected for:
Chemical Analysis? ☐ Yes ☒ No
Bacteriological Analysis? ☐ Yes ☒ No
If so, to what laboratory was it sent? _____

6. WELL CONSTRUCTION
Diameter of hole 7 inches. Depth 100 feet.
Casing: ☐ Steel ☒ Plastic ☐ Concrete ☐ Threaded ☐ Welded ☐ Other
If other, specify _____

Pipe Weight:	Diameter:	From:	To:
____lb/ft	____inches	____feet	____feet
____lb/ft	____inches	____feet	____feet
____lb/ft	____inches	____feet	____feet

Was perforated pipe used? ☐ Yes ☐ No
Perforated pipe set from 85 ft. to 100 feet
Was casing left open end? ☒ Yes ☐ No
Was a well screen installed? ☐ Yes ☐ No
Material _____ Diameter _____ inches
Slot Size _____ set from _____ feet to _____ feet
Slot Size _____ set from _____ feet to _____ feet
Was packer or seal used? ☐ Yes ☒ No
If so, what material _____ Depth _____ ft.
Type of well: Straight screen ☐ Gravel packed ☒
Depth grouted: From 0 To 30'
Grouting Material: Cement Bentonite Other _____
If other, explain: _____
Well head completion: Pitless unit _____
12" above grade ✓ Other _____
If other, specify _____
Was pump installed? ☒ Yes ☐ No
Was well disinfected upon completion? ☒ Yes ☐ No

7. WATER LEVEL
Static water level 70 feet below surface
If flowing: closed-in pressure _____ psi
GPM flow _____ through ____ inch pipe
Controlled by: ☐ Valve ☐ Reducers ☐ Other
If other, specify _____

8. WELL TEST DATA
☐ Pump ☒ Bailer ☐ Other
Pumping level below land surface:
80 ft. after 1 hrs. pumping 10 gpm
____ ft. after ____ hrs. pumping ____ gpm
____ ft. after ____ hrs. pumping ____ gpm

9. WELL LOG

Formation	Depth (ft.) From	Depth (ft.) To
Top Soil	0	2
yellow Sand	2	15
sandy Clay	15	45
Coal	45	46
Clay	46	55
Sand	55	100

(Use separate sheet if necessary)

10. DATE COMPLETED Aug 22 - 05

11. WAS WELL PLUGGED OR ABANDONED?
☐ Yes ☒ No
If so, how _____

12. REMARKS:

13. DRILLER'S CERTIFICATION
This well was drilled under my jurisdiction and this report is true to the best of my knowledge.

Beaudoin Drilling 55
Driller's or Firm's Name Certificate No.
921 14th Ave W
Address
Dickinson ND 58601
Signed by Wallace Beaudoin Date

WHITE-DRILLER'S COPY YELLOW-BOARD'S COPY PINK-CUSTOMER'S COPY