STATE OF NORTH DAKOTA

BOARD OF WATER WELL CONTRACTORS

900 E. BOULEVARD • BISMARCK, NORTH DAKOTA 58501

WELL DRILLER'S REPORT

State law requires that this report be filed with the State Board of Water Well Contractors within 30 days after completion or abandonment of the well.

1. WELL OWNER

Name Kenneth Bergo

Address Bismarck

2. WELL LOCATION

Sketch map location must agree with written location.

NORTH

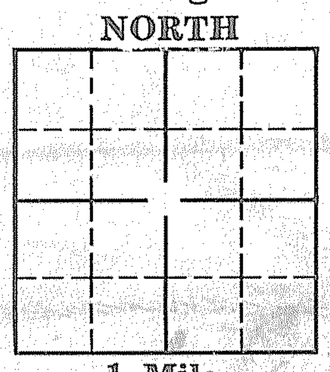

1 Mile

County Burleigh

¼ SW ¼ SE ¼ Sec. 4 Twp. 138 N. Rg. 79 W.

3. PROPOSED USE

☐ Domestic ☑ Irrigation ☐ Industrial
☐ Stock ☐ Municipal ☐ Test Hole

4. METHOD DRILLED

☐ Cable ☐ Reverse Rotary ☐ Bored
☑ Forward Rotary ☐ Jetted ☐ Other

If other, specify

5. WATER QUALITY

Was a water sample collected for chemical analysis?

☐ Yes ☑ No

If so, to what laboratory was it sent

6. WELL CONSTRUCTION

Diameter of hole 7 3/5 inches. Depth 40 feet.

Casing: ☐ Steel ☑ Plastic ☐ Concrete
☐ Threaded ☐ Welded ☐ Other

If other, specify

Pipe Weight:	Diameter:	From:	To:
Sch 40 lb/ft.	4 inches	0 feet	40 feet
lb/ft.	inches	feet	feet
lb/ft.	inches	feet	feet
lb/ft.	inches	feet	feet

Was perforated pipe used? ☐ Yes ☑ No

Length of pipe perforated feet

Was casing left open end? ☐ Yes ☒ No

Was a well screened installed? ☒ Yes ☐ No

Material PVC Diameter 4 inches
(stainless steel, bronze, etc.)

Slot size 8 set from 35 feet to 40 feet

Slot size set from feet to feet

Slot size set from feet to feet

Slot size set from feet to feet

Was a packer or seal used? ☐ Yes ☑ No

If so, what material

Type of well: Straight screen ☐ Gravel packed ☒

Was the well grouted? Yes ☒ No ☐

To what depth? 10 feet

Material used in grouting cement

Well head completion: Pitless adapter no

12" above grade yes Other

If other, specify

Was well disinfected upon completion? ☐ Yes ☑ No

7. WATER LEVEL

Static water level 15 feet below land surface

If flowing: closed-in pressure psi

GPM flow through inch pipe

Controlled by: ☐ Valve ☐ Reducers ☐ Other

If other, specify

8. WELL TEST DATA

☒ Pump ☐ Bailer ☐ Other

Pumping level below land surface:

ft. after hrs. pumping gpm

ft. after hrs. pumping gpm

ft. after hrs. pumping gpm

9. WELL LOG

Formation	Depth (ft.) From	Depth (ft.) To
top Soil	0	2
Silt	2	25
Fine Sand	25	40

(Use separate sheet if necessary.)

10. DATE COMPLETED 6-25-83

11. WAS WELL PLUGGED OR ABANDONED?

☐ Yes ☑ No

If so, how

12. REMARKS:

13. DRILLER'S CERTIFICATION

This well was drilled under my jurisdiction and this report is true to the best of my knowledge.

H.L. McLean Drilling 65

Driller's or Firm's Name Certificate No.

Route #5 Bismarck

Address

[signature] 12-29-83

Signed by Date

DUPLICATE — BOARD'S COPY