

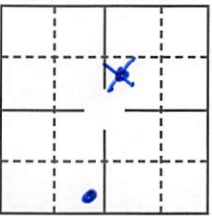


WELL DRILLER'S REPORT
NORTH DAKOTA BOARD OF WATER WELL CONTRACTORS
STATE OF NORTH DAKOTA
SFN 60273 (8/2023)

RECEIVED

NOV 24 2023

ND Board of Water Well Contractors • 1200 Memorial Highway • Bismarck, ND, 58504 ND DEPT. OF WATER RESOURCES
State law requires that this report be filed with the State Board of Water Well Contractors within 30 days after completion or abandonment of the well.

WELL OWNER				Was Pump Installed? ☐ Yes ☒ No <i>future solar</i>			
Name <i>U.S. Forest Service</i>				Was Well Disinfected Upon Completion? ☒ Yes ☐ No			
Address <i>1601 Main St Bismarck ND 58054</i>				WATER LEVEL			
WELL LOCATION Sketch map location must agree with written location.				Static Water Level (In Feet) Below Surface <i>4</i>			
				If Flowing, Closed-In Pressure In PSI			
County <i>Ransom</i> GPS				GPM Flow Through Inch Pipe			
1/4 <i>SE</i> 1/4 <i>SE</i> 1/4 <i>SW</i>				Controlled By ☐ Valve ☐ Reducers ☐ Other			
Township <i>134N</i> Range <i>52W</i> Section <i>4</i>				☐ If Other, Specify			
PROPOSED USE <i>13405204CDD</i>				WELL TEST DATA			
☐ Domestic ☐ Geothermal ☐ Municipal ☐ Industrial				☒ Pump ☐ Bailer ☐ Other			
☒ Stock ☐ Irrigation ☐ Monitoring ☐ Test Hole				Pumping Level Below Land Surface			
METHOD DRILLED				Feet After <i>12</i> Hrs. Pumping <i>2</i> GPM <i>75</i>			
☐ Cable ☐ Jetted ☒ Forward Rotary ☐ Reverse Rotary				Feet After Hrs. Pumping GPM			
☐ Bored ☐ Auger ☐ If Other, Specify				Feet After Hrs. Pumping GPM			
WATER QUALITY Was a water sample collected for				WELL LOG			
Chemical Analysis? ☐ Yes ☒ No				Formation Depth (ft.)			
Bacteriological Analysis? ☐ Yes ☒ No				From To			
If So, To What Laboratory Was It Sent?				<i>Brown sand</i> <i>0</i> <i>6</i>			
WELL CONSTRUCTION				<i>silty water sand</i> <i>6</i> <i>11</i>			
Diameter Of Hole In Inches <i>7 1/2</i> Depth In Feet <i>30</i>				<i>Coarse water sand (pearl rock)</i> <i>11</i> <i>30</i>			
Casing: ☐ Steel ☒ Plastic ☐ Concrete ☐ Other							
☐ Threaded ☐ Welded ☐ If Other, Specify							
Pipe Weight Diameter From To							
<i>220</i> <i>4</i> <i>20</i> <i>+2</i>							
lb/ft inches feet feet							
lb/ft inches feet feet							
lb/ft inches feet feet							
Was A Well Screen Installed? ☒ Yes ☐ No							
Was Perforated Pipe Used? ☐ Yes ☒ No							
Screen Or Perforation Interval From In Feet To In Feet							
<i>30</i> <i>20</i>							
Was Casing Left Open End? ☐ Yes ☒ No							
Material <i>PVC</i> Diameter In Inches <i>4</i>							
Slot Size Set From In Feet To In Feet							
<i>15</i> <i>30</i> <i>20</i>							
Slot Size Set From In Feet To In Feet							
Was Packer Or Seal Used? ☐ Yes ☒ No							
If So, What Material Depth In Feet							
☐ Straight Screen ☒ Gravel Packed							
Depth Grouted From To							
<i>20</i> <i>surface</i>							
Grouting Material Cement Other							
If Other, Explain:							
Well Head Completion: Pitless Unit <i>Well seal</i>				DATE COMPLETED <i>10/22/23</i>			
12" Above Grade Other (Specify)				WAS WELL PLUGGED OR ABANDONED? ☐ Yes ☒ No			
If Other, Specify				If So, How			
				REMARKS			
				<i>pumped good</i>			
				DRILLER'S CERTIFICATION			
This well was drilled under my jurisdiction and this report is true to the best of my knowledge.				Driller's Or Firm's Name Certificate Number			
<i>Sh. Javandal / Andy Koberg</i> <i>#109</i>							
Address <i>Walepte ND</i>							
Signed By <i>Sh. Javandal</i> Date <i>11/20/23</i>							