



WELL DRILLER'S REPORT
NORTH DAKOTA BOARD OF WATER WELL CONTRACTORS
STATE OF NORTH DAKOTA
SFN 60273 (8/2020)

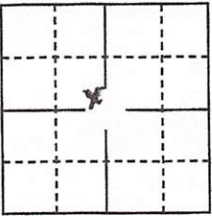
RECEIVED

DEC 15 2025

ND DEPT. OF WATER RESOURCES

ND Board of Water Well Contractors • 900 E. Boulevard Ave. - Dept. 770 • Bismarck, ND, 58505-0850

State law requires that this report be filed with the State Board of Water Well Contractors within 30 days after completion or abandonment of the well.

WELL OWNER		Was Pump Installed? ☒ Yes ☐ No	
Name <u>Linda Hugelen</u>		Was Well Disinfected Upon Completion? ☒ Yes ☐ No	
Address <u>P.O. Box 458 Fort Yates ND 58533</u>		WATER LEVEL	
WELL LOCATION Sketch map location must agree with written location.		Static Water Level (In Feet) Below Surface <u>112.4</u>	
	County <u>Sioux</u>	GPS <u>46°02'21.31" N</u> <u>101°01'58.79" W</u>	
	1/4 <u>SE 1/4</u>	1/4 <u>SE</u>	1/4 <u>NW</u>
	Township <u>130</u>	Range <u>83</u>	Section <u>35</u>
PROPOSED USE <u>1300R335BDD</u>		WELL TEST DATA	
☒ Domestic ☐ Geothermal ☐ Municipal ☐ Industrial ☐ Stock ☐ Irrigation ☐ Monitoring ☐ Test Hole		☐ Pump ☐ Bailer ☒ Other <u>Air lift</u>	
METHOD DRILLED		Pumping Level Below Land Surface	
☐ Cable ☐ Jetted ☒ Forward Rotary ☐ Reverse Rotary ☐ Bored ☐ Auger ☐ If Other, Specify _____		Feet After <u>5 hrs</u> Hrs. Pumping <u>15+</u> GPM	
WATER QUALITY Was a water sample collected for		Feet After _____ Hrs. Pumping _____ GPM	
Chemical Analysis? ☐ Yes ☐ No		Feet After _____ Hrs. Pumping _____ GPM	
Bacteriological Analysis? ☐ Yes ☐ No		WELL LOG	
If So, To What Laboratory Was It Sent? <u>MVTL</u>		Formation	
WELL CONSTRUCTION		Depth (ft.)	
Diameter Of Hole In Inches <u>8 1/2"</u> Depth In Feet <u>220'</u>		From To	
Casing: ☐ Steel ☒ Plastic ☐ Concrete ☐ Other ☐ Threaded ☐ Welded ☐ If Other, Specify _____		<u>Top soil</u> 0 1	
Pipe Weight	Diameter	From	To
lb/ft <u>2.91</u>	inches <u>5" 20</u>	feet <u>1 1/2 above</u>	feet <u>220'</u>
lb/ft	inches	feet	feet
lb/ft	inches	feet	feet
Was A Well Screen Installed? ☒ Yes ☐ No		<u>Brown-yellow clay</u> 1 24	
Was Perforated Pipe Used? ☒ Yes ☐ No		<u>Brown-yellow sandy clay</u> 24 35	
Screen Or Perforation Interval	From In Feet	To In Feet	<u>Gray sandy clay to gray clay</u> 35 45
<u>Perforated</u>	<u>218'</u>	<u>220'</u>	<u>Gray-Blue sandy clay</u> 45 59
Was Casing Left Open End? ☐ Yes ☒ No			<u>Light Gray & Brown clay</u> 59 104
Material <u>PVC SDR-21</u>	Diameter In Inches <u>5"</u>	<u>Gray sandy clay & sand</u> 104 108	
Slot Size <u>0.20</u>	Set From In Feet <u>195'</u>	To In Feet <u>215'</u>	<u>Light Gray to Brown to sandy clay</u> 108 114
Slot Size <u>Solid</u>	Set From In Feet <u>215'</u>	To In Feet <u>220'</u>	<u>Light gray & dark clay</u> 114 153
Was Packer Or Seal Used? ☐ Yes ☒ No			<u>Gray Blue sand to sandy clay</u> 153 165
If So, What Material	Depth In Feet	<u>Brown to gray clay</u> 165 183	
Type Of Well ☐ Straight Screen ☒ Gravel Packed			<u>Blue-gray fine & coarse sand</u> 183 215
Depth Grouted <u>165'</u>	From <u>5'</u>	To <u>170'</u>	<u>Brown to gray sandy clay</u> 215 220
Grouting Material <u>Granular Bentonite</u>	Cement	Other <u>15 Bags</u>	
If Other, Explain: <u>Pumped grout in from bottom up through 1" tremie pipe</u>			
Well Head Completion: Pitless Unit <u>Monitor 5' x 7' Bury</u>			
12" Above Grade <u>6" pipe 14" above grade</u>	Other (Specify)		
If Other, Specify			
		Use Separate Sheet If Necessary	
		DATE COMPLETED <u>3-30-2025</u>	
		WAS WELL PLUGGED OR ABANDONED? ☒ Yes ☐ No	
		If So, How	
		REMARKS	
		DRILLER'S CERTIFICATION	
		This well was drilled under my jurisdiction and this report is true to the best of my knowledge.	
		Driller's Or Firm's Name <u>Gregg's Drilling & Excav</u>	Certificate Number <u>111</u>
		Address <u>506 1st St. East Mobridge, SD 57601</u>	
		Signature <u>Duff G. Newski</u>	Date <u>4-4-2025</u>