WELL DRILLER'S REPORT
NORTH DAKOTA DEPARTMENT OF WATER RESOURCES
WATER APPROPRIATION
SFN 60273 (7/2025)

RECEIVED
AUG 12 2026
ND DEPT. OF WATER RESOURCES

Department of Water Resources • 1200 Memorial Highway • Bismarck, ND, 58504
State law requires that this report be filed with the Department of Water Resources within 30 days after completion or abandonment of the well.

WELL OWNER
Name: Mark Olson
Address: 16351 57th St SE, Kindred, ND 58051

WELL LOCATION
Sketch map location must agree with written location.

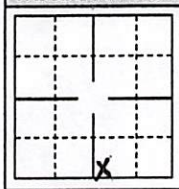

County	GPS	
Richland		
1/4: SW	1/4: SW	1/4: SE
Township: 136	Range: 50	Section: 17

PROPOSED USE
136050 17DCC

☒ Domestic ☐ Geothermal ☐ Municipal ☐ Industrial
☐ Stock ☐ Irrigation ☐ Monitoring ☐ Test Hole

METHOD DRILLED
☐ Cable ☐ Jetted ☒ Forward Rotary ☐ Reverse Rotary
☐ Bored ☐ Auger ☐ If Other, Specify

WATER QUALITY
Was a water sample collected for
Chemical Analysis? ☒ Yes ☐ No
Bacteriological Analysis? ☒ Yes ☐ No
If So, To What Laboratory Was It Sent? RMB

WELL CONSTRUCTION
Diameter Of Hole In Inches: 6 3/4
Depth In Feet: 164

Casing:
☐ Steel ☒ Plastic ☐ Concrete ☐ Other
☐ Threaded ☒ Welded ☐ If Other, Specify

Pipe Weight	Diameter	From	To
lb/ft 1.94	inches 4	feet 0	feet 150
lb/ft	inches	feet	feet
lb/ft	inches	feet	feet

Was A Well Screen Installed? ☒ Yes ☐ No
Was Perforated Pipe Used? ☐ Yes ☒ No
Screen Or Perforation Interval: From In Feet / To In Feet
Was Casing Left Open End? ☐ Yes ☒ No

Material: Stainless Steel
Diameter In Inches: 3

Slot Size	Set From In Feet	To In Feet
.015	150	154

Was Packer Or Seal Used? ☐ Yes ☒ No
If So, What Material / Depth In Feet

Type Of Well: ☐ Straight Screen ☒ Gravel Packed

Depth Grouted	From	To
140	0	140

Grouting Material	Cement	Other
	x	

If Other, Explain:
Well Head Completion: Pitless Unit x
12" Above Grade / Other (Specify)
It Other, Specify

Was Pump Installed? ☒ Yes ☐ No
Was Well Disinfected Upon Completion? ☒ Yes ☐ No

WATER LEVEL
Static Water Level (In Feet) Below Surface: Ground Level
If Flowing, Closed-In Pressure In PSI
GPM Flow Through Inch Pipe
Controlled By ☐ Valve ☐ Reducers ☐ Other
☐ If Other, Specify

WELL TEST DATA
☐ Pump ☐ Bailer ☒ Other
Pumping Level Below Land Surface

Feet After	Hrs. Pumping	GPM
105	7	75

WELL LOG

Formation	Depth (ft.) From	To
Top Soil	0	2
Siltly sandy clay	2	16
Clay	16	23
Sand	23	26
Sandy clay	26	132
Hard sandy clay	132	149
Gravel	149	154
Sandy clay	154	164

Use Separate Sheet If Necessary

DATE COMPLETED 8/5/26

WAS WELL PLUGGED OR ABANDONED? ☐ Yes ☒ No
If So, How

REMARKS

DRILLER'S CERTIFICATION
This well was drilled under my jurisdiction and this report is true to the best of my knowledge.

Driller's Or Firm's Name: LTP Enterprises, Inc
License Number: 136
Address: PO Box 9035 Fargo, ND 58106
Signed By: Chris Ranum
Date: 8/6/26

COPY FOR DWR COPY FOR DRILLER COPY FOR CUSTOMER