



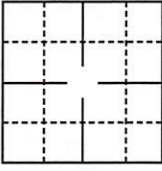
WELL DRILLER'S REPORT
NORTH DAKOTA BOARD OF WATER WELL CONTRACTORS
STATE OF NORTH DAKOTA
SFN 60273 (11/2013)

RECEIVED

AUG 17 2026

ND DEPT. OF WATER RESOURCES

ND Board of Water Well Contractors • 900 E. Boulevard Ave. - Dept. 770 • Bismarck, ND, 58505-0850
State law requires that this report be filed with the State Board of Water Well Contractors within 30 days after completion or abandonment of the well.

WELL OWNER				Was pump installed? ☐ Yes ☒ No			
Name Little Missouri Grazing Association				Was well disinfected upon completion? ☒ Yes ☐ No			
Address				WATER LEVEL			
WELL LOCATION Sketch map location must agree with written location.				Static water level (in feet) below surface 216			
		County Slope		GPS		If flowing, closed-in pressure in psi	
		1/4 NE	1/4 NE	1/4 NW	GPM flow Through inch pipe		
		Township 135	Range 105	Section 6	Controlled by ☐ Valve ☐ Reducers ☐ Other ☐ If other, specify		
PROPOSED USE 13510506BAA				WELL TEST DATA			
☐ Domestic ☐ Geothermal ☐ Municipal ☐ Industrial ☒ Stock ☐ Irrigation ☐ Monitoring ☐ Test Hole				☒ Pump ☐ Bailer ☐ Other Air			
METHOD DRILLED				Pumping level below land surface			
☐ Cable ☐ Jetted ☒ Forward Rotary ☐ Reverse Rotary ☐ Bored ☐ Auger ☐ If other, specify				Feet after 450 Hrs. pumping 8 gpm 5			
WATER QUALITY Was a water sample collected for				Feet after Hrs. pumping gpm			
Chemical Analysis? ☐ Yes ☒ No				Feet after Hrs. pumping gpm			
Bacteriological Analysis? ☐ Yes ☒ No				Feet after Hrs. pumping gpm			
If so, to what laboratory was it sent?				WELL LOG			
WELL CONSTRUCTION				Formation Depth (ft.)			
Diameter of hole in inches 8.75		Depth in feet 609		From To			
Casing: ☐ Steel ☒ Plastic ☐ Concrete ☐ Other ☐ Threaded ☐ Welded ☐ If other, specify				Clay / coal stringers 0 98			
Pipe Weight	Diameter	From	To	Sand 98 111			
lb/ft	inches	feet	feet	Clay 111 142			
2.9	5	+2	549	Coal 142 152			
lb/ft	inches	feet	feet	Clay 152 241			
lb/ft	inches	feet	feet	Sand 241 253			
				Clay 253 523			
				Clay with Sand stringers 523 555			
				Sand 555 580			
				Clay 580 595			
				Sand 595 609			
				Clay			
Was perforated pipe used? ☐ Yes ☒ No				(Use separate sheet if necessary)			
Perforated pipe set from in feet		To in feet		DATE COMPLETED 6-10-26			
Was casing left open end? ☐ Yes ☒ No		Was a well screen installed? ☒ Yes ☐ No		WAS WELL PLUGGED OR ABANDONED?			
Material		Diameter in inches 5		☐ Yes ☒ No			
Slot Size	Set from in feet	To in feet		If so, how			
25	549	609		REMARKS			
Slot Size	Set from in feet	To in feet		#10 46.53954,-103.91670			
Was packer or seal used? ☐ Yes ☐ No				DRILLER'S CERTIFICATION			
If so, what material		Depth in feet		This well was drilled under my jurisdiction and this report is true to the best of my knowledge.			
Type of well ☐ Straight screen ☒ Gravel packed		Depth grouted From To		Driller's or Firm's Name		Certificate Number	
Grouting Material Bentonite		Cement Other		Brase Drilling LLC		179	
If other, explain:				Address 2813 Hwy 2 West Rugby ND 58368			
Well head completion: Pitless unit				Signed by Ben Brase			
12" above grade Yes		Other		Date 7-10-26			
If other, specify							